

# S42100 / S52100 / S50050

Order-No.: S42100 - Temperature Sensor TP

S52100 – Temperature Humidity Sensor KP S50050 – Weather- and Radiation Shield


#### Measurement principle

The temperature humidity sensors are compact sensors in a roddesign with plug-in connection to measure relative humidity and temperature (individually or together) with high precision in air an other non-aggressive gases. The delivery includes the coupling plug.

The relative humidity is measured by a capacitive sensing element and the value will be placed at the output as analog output as well.



## Dimensional drawing

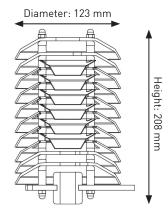

Overall height including bracket: 300 mm Weight: 1.01 kg

#### Mounting

The sensors are to be mounted at a climate representative spot. For protection against rain and direct radiation a weather and radiation shield should be used, which can be simply fixed to a mast.

#### Please order the weather and radiation shield separately!

Take care of a good ventilation of the sensing element. any mouting position is possible. Avoid penetration of water. Dew-formation does not do any harm to the element, but faulty measurements will occur until total drying.

### Maintenance

The temperature sensor is maintenance-free. Only check the output after long use with a precise reference thermometer.

It is possible to make functional gauging of the humidity sensor. To do this, the sensor has to be exposed to a known reference humidity, e.g., the available "humidity-standard" calibration set. If you unscrew the protection filter, keep in mind never to touch the element with fingers or any tool.





S42100 / S52100 / S50050

# **Specifications**

Туре	Temperature Sensor	Humidity Sensor	
Measurement principle	Pt100 1/3 DIN acc. DIN EN 60751	Capacitive	
Measurement range	-30 +70 °C	0 100% RH	
Slope (Data Logger Meteo-40)	100	100	
Offset (Data Logger Meteo-40)	-30	0	
Accuracy			
Accuracy	± 0.2 K (-27 +80 °C)	± 2% RH (5 95% RH @ 10 40 °C)	
Additional error	± 0.007 K/K (<10 °C, >40 °C)	< 0.1 %/K (<10 °C, >40 °C)	
Operating range			
Ambient temperature	-40 +80 °C		
Minimum air speed (across sensor)	≥ 0.5 m/s		
Electrical data			
Output signal	0 1 V	0 1 V	
Operating supply	6 30 VDC		
Current Consumption @ 12 V DC	2 mA		
General			
Connection	7-pol plug for shielded cable		
Dimensions	Sensor: 155 x Ø 20 mm		
	Weather and radiation shield: see dimensional drawing		
Weight	Sensor: approx. 0.1 kg Weather and radiation shield: 1.01 kg		
Protection Sensor	IP 30		
Protection Electronic	IP 65		
Protection Coupling	IP 67		
Manufacturer	Galltec		



S42100 / S52100 / S50050

## Sensor connection to Ammonit Meteo-40 data logger

TP (temperature only!) - Meteo-40 Order-No. S42100


Sensor	Plug Pin No.	Ammonit Cable Wire Colour	Meteo-40 Analog Voltage	Supply Sensor
Temperature Output Voltage	3	white	Ax	
Ground	2	blue	Вх	
Supply	4	red		9 30 VDC*
Ground	1	black		Main Ground

<sup>\*</sup>Supply voltage for usage with Meteo-40 data loggers

Cable type: LiYCY 4 x 0.25 mm<sup>2</sup>

Connect the shield logger-sided to Ground (GND)

### Sensor connection diagram to Ammonit Meteo-40 data logger

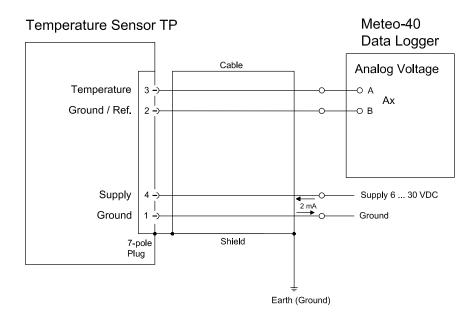



S42100 / S52100 / S50050

## Sensor connection to Ammonit Meteo-40 data logger

KP (temperature + humidity) - Meteo-40 Order-No. S52100


Sensor	Plug Pin No.	Ammonit Cable Wire Colour	Meteo-40 Analog Voltage	Supply Sensor
Temperature Output Voltage	7	white	Ax	
Ground	5	blue	Вх	
Humidity Output Voltage	3	brown	Ax+1	
Ground	2	pink	Bx+1	
Supply	4	red		9 30 VDC*
Ground	1	black		Main Ground

<sup>\*</sup>Supply voltage for usage with Meteo-40 data loggers

Cable type: LiYCY 6 x 0.25 mm<sup>2</sup>

Connect the shield logger-sided to Ground (GND)

## Sensor connection diagram to Ammonit Meteo-40 data logger

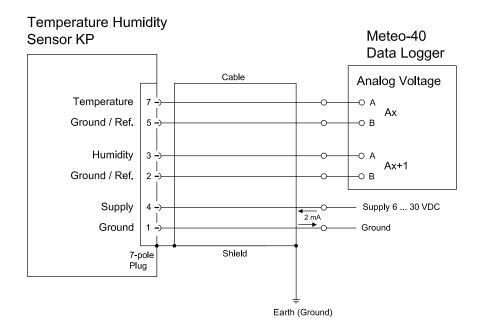

Last Modification: 15 February 2024